



IMPORTANT SAFETY RECALL

NHTSA Recall 21C-005


Clek Inc. has decided that a defect which relates to motor vehicle safety exists in Clek Foanf and Filo Convertible Car Seats manufactured prior to May 21, 2021.

Clek Foanf convertible car seat affected:

Model Name: FO12, FO14, FO15, FO16, FO17, FO18, FO19
Manufactured on: 2012/12/03 - 2021/05/20

Clek Filo convertible car seat affected:

Model Name: FL15, FL16, FL17, FL18, FL19
Manufactured on: 2014/07/05 - 2021/05/20

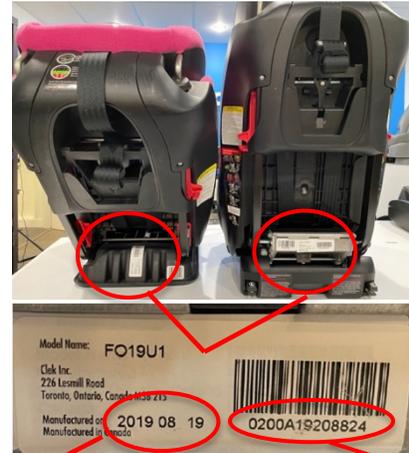

Manufactured on Date

Serial Number

Description of the safety defect:

Clek has determined that it is possible for a child to place their fingers through the crotch buckle opening and pick at the foam seat cushion on the subject car seats. After repeated picking, a child may be able to remove small pieces of Expanded Polypropylene (EPP) foam and put the small pieces into their mouth, posing a potential choking hazard and increasing the risk of injury. The foam pieces that are picked off are small (about 5 mm) with no sharp edges. This foam is non-toxic and does not pose a chemical concern if it were to be ingested.

This issue does NOT affect the ability of the child restraint system to protect the occupant in the event of a motor vehicle crash.



Crotch buckle opening



EPP foam seat cushion

Remedy of the safety defect:

Clek will be providing a plastic insert to cover the foam around the crotch buckle opening to help prevent access to the foam. It is safe to use your car seat while waiting to receive a kit to fix the issue.

Clek will notify all registered owners of affected car seats. This notice will explain the issue and include instructions for how to get a free kit to fix the issue.

Owners of affected car seats, including those who have not registered their car seat, or have moved, should contact Clek:

- Online: www.clekinc.com/seatcushioninsert
- By email: seatcushioninsert@clekinc.com
- By telephone: 1-866-656-2462



EPP foam seat cushion with plastic insert installed